




Droid Ultra XT1080 Charging Port Replacement

How to replace a Motorola Droid Ultra charging port.

Written By: knoyes

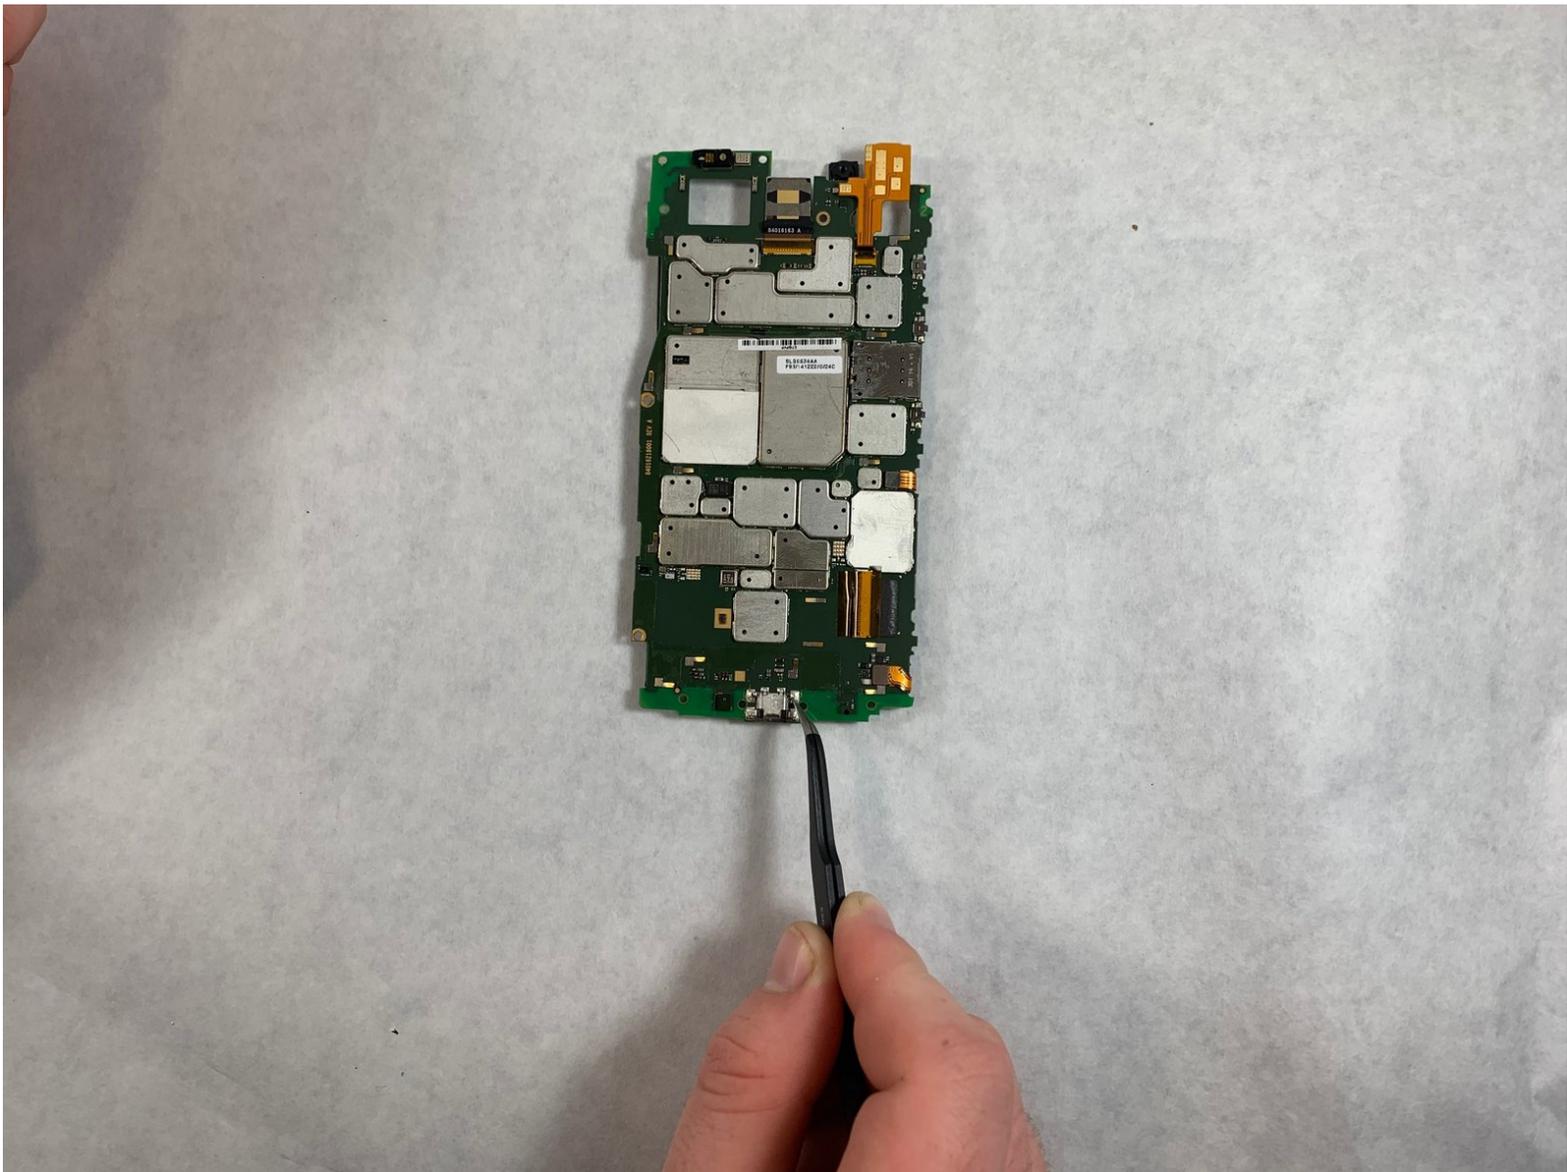

INTRODUCTION

This guide will teach you how to replace the charging port of your device.

TOOLS:

- [iFixit Opening Tools](#) (1)
 - [Spudger](#) (1)
 - [T5 Torx Screwdriver](#) (1)
 - [T4 Torx Screwdriver](#) (1)
 - [Soldering Iron](#) (1)
-

Step 1 — Charging Port




- Remove SIM card tray from the device with a plastic opening tool.

Step 2



- Once SIM card tray is removed press the spudger between the plastic case and the frame of the device until you hear a snap.
 - Work your way around the device until all the plastic clips are undone.
- ⚠ Be gentle with the plastic to make sure it doesn't break.

Step 3

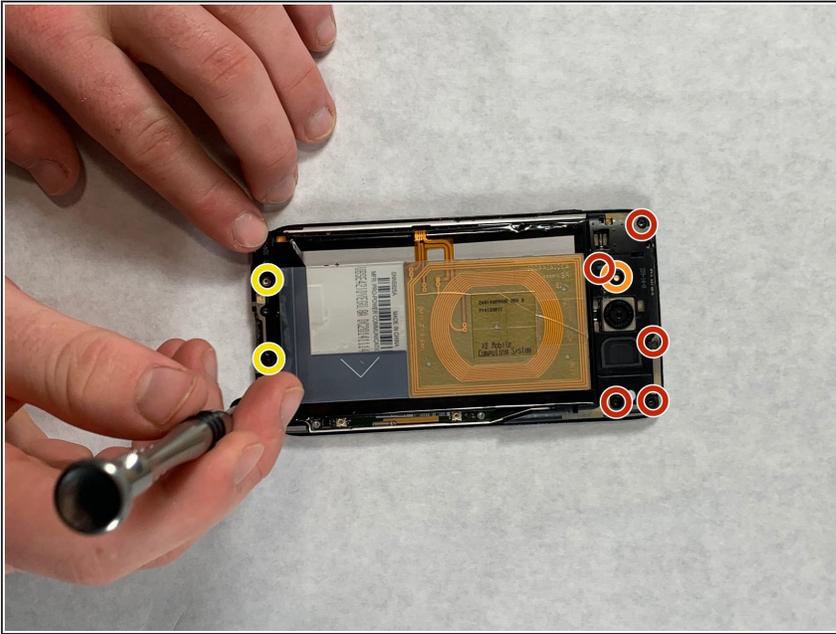


- Remove the five screws on top of the device with a T5 Torx.
- Remove the single screw holding the camera with a T4 Torx.
- Remove the two screws on the bottom of the device with a T5 Torx.

Step 4




- Once the screws are removed, use a plastic spudger and lift up the two plastic pieces that were secured by the screws.

Step 5

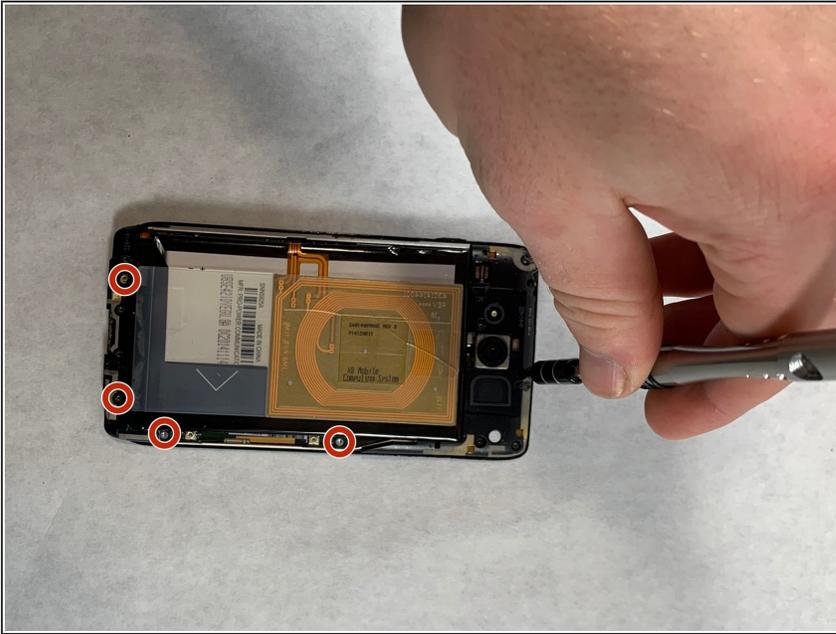



- Remove the four T5 Torx screws securing the motherboard.

Step 6

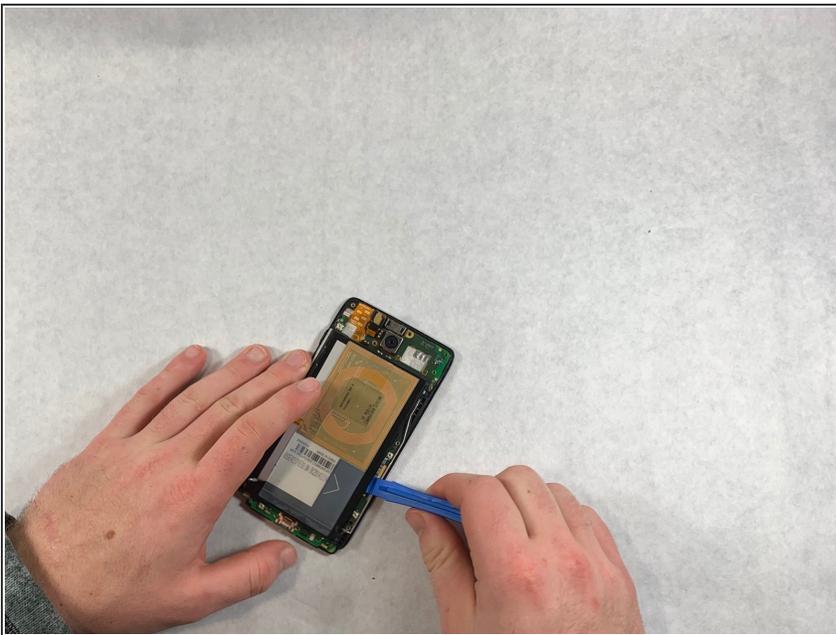


- Gently pry the motherboard out of the frame of the device.

Step 7

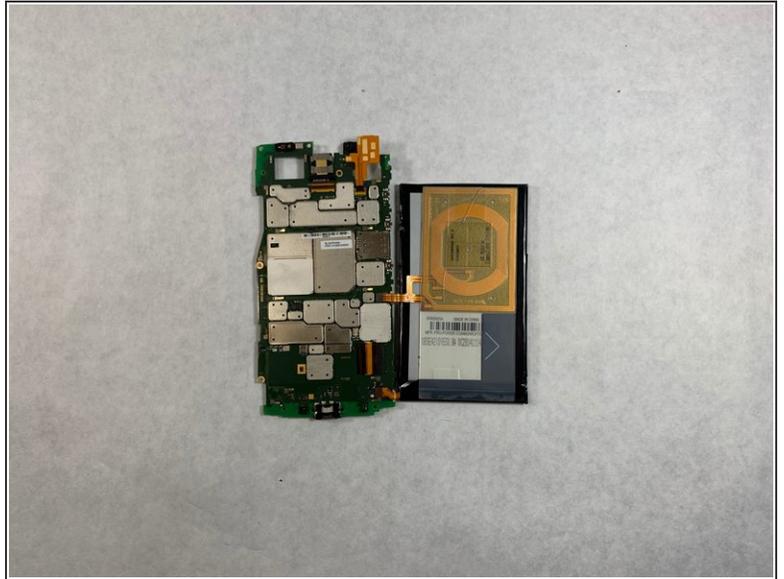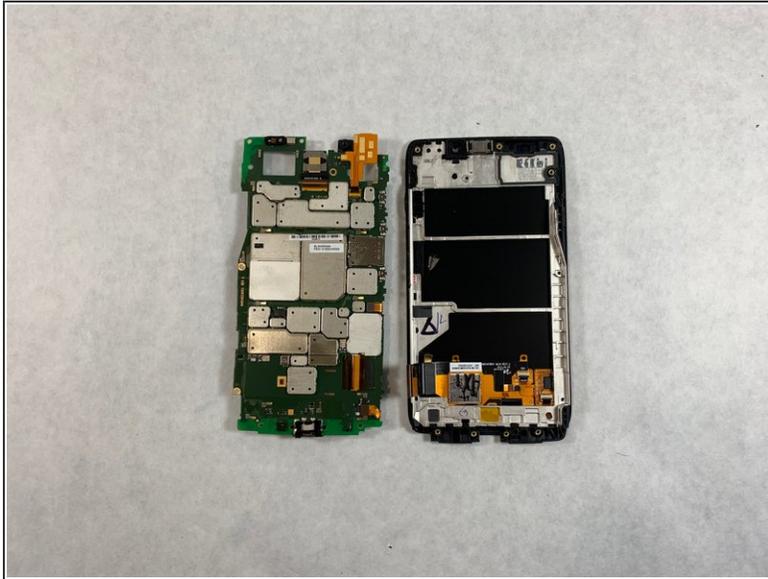

- Once the motherboard is free flip it over on its back so all the components are showing.

Step 8

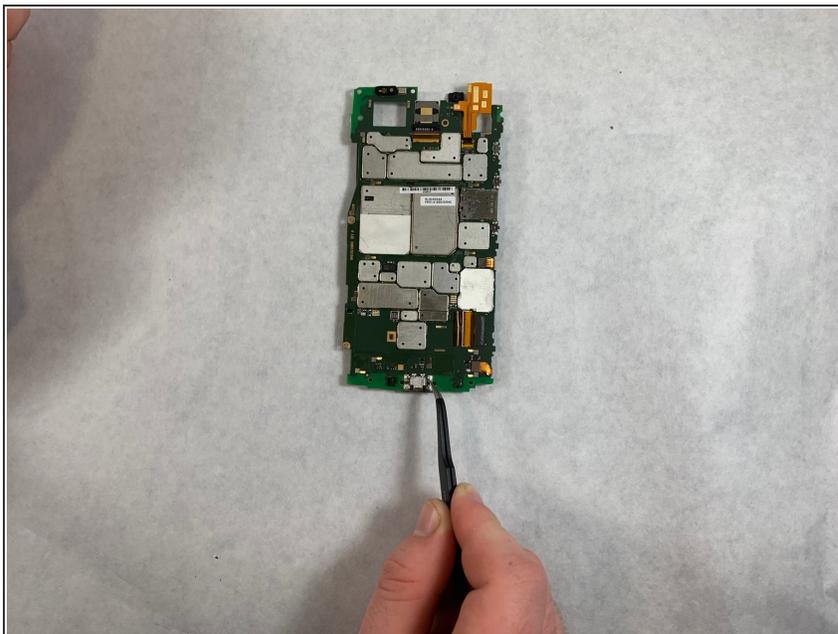

- To fully replace the charging port you need to desolder the port and solder a new one in.

To reassemble your device, follow these instructions in reverse order.