



Asus Zenfone 3 Max Battery Replacement

Battery replacement guide for the Asus Zenfone 3 Max.

Written By: Lauren Compton



INTRODUCTION

If your Asus Zenfone 3 Max phone fails to charge, it could be due to a malfunctioning or damaged device battery. This guide will help you remove your phone battery and replace it with a new one. Before you begin, please note that the replacement of battery must be done with great care, as you can potentially damage other parts of the device. For additional information, access the troubleshooting page [here](#).

When replacing the battery, first make sure it is not swollen. Visit this [page](#) in order to learn more and take any necessary precautions.



TOOLS:

- [iFixit Opening Tools](#) (1)



PARTS:

- [Asus Zenfone 3 Max Replacement Battery](#) (1)

Step 1 — Back cover



- Using an iFixit opening tool, gently wedge the tool between the phone and the back casing.
- Move the opening tool up and down to pry the back off of the device.

Step 2




- ☑ Once the original cover has been removed, apply the new cover to the back of the phone with careful pressure.

Step 3 — Battery



- Gently disconnect the gold connection cable indicated by the red circle in the corresponding picture.
- Pull back on the black adhesive tab that is adhered to the top of the battery. Tab removal is marked in the corresponding picture with a orange circle.
- ⓘ Once the gold connection cable and black adhesive tab are no longer connected to the battery, the battery can be removed.

Step 4

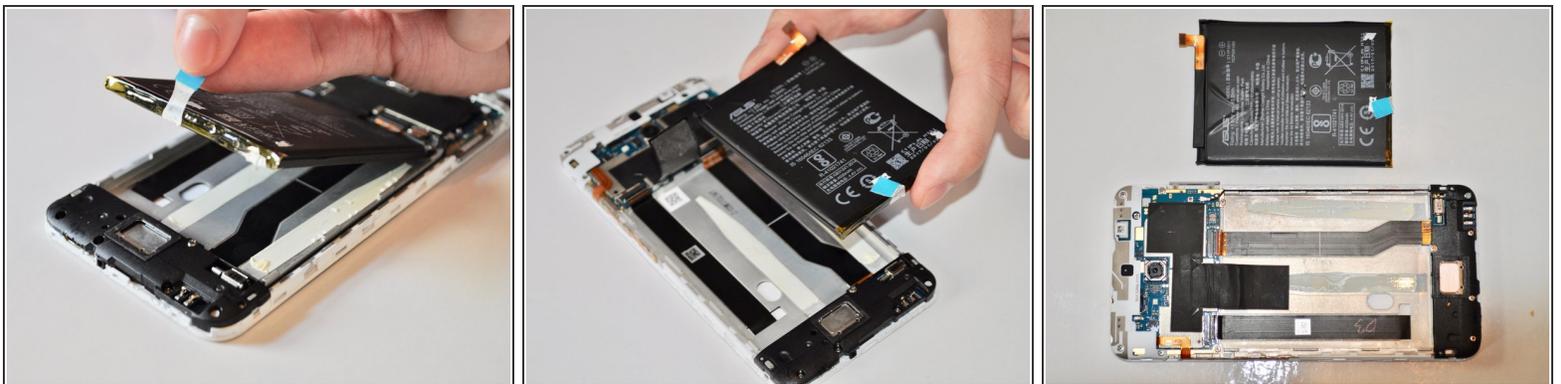

- Next, remove the battery by gently pulling on the blue removal tab located at the bottom of the device battery.
- Completely remove existing device battery.

To reassemble your device, follow these instructions in reverse order.

This document was generated on 2020-11-28 07:36:36 AM (MST).

